

Volkswagen Golf

Bluetooth 3C8 - installation guide
v. 1.0.



Product description:


1 pc	Bluetooth module
1 pc	Microphone
1 pc	Foam cover
1 pc	GSM antenna
1 pc	Plug&Play wire

1



Dismantle the radio. First, lever up and take away the casing. Then unscrew the radio.

**2**

Once the radio is dismantled, stretch and connect up wires as shown below.

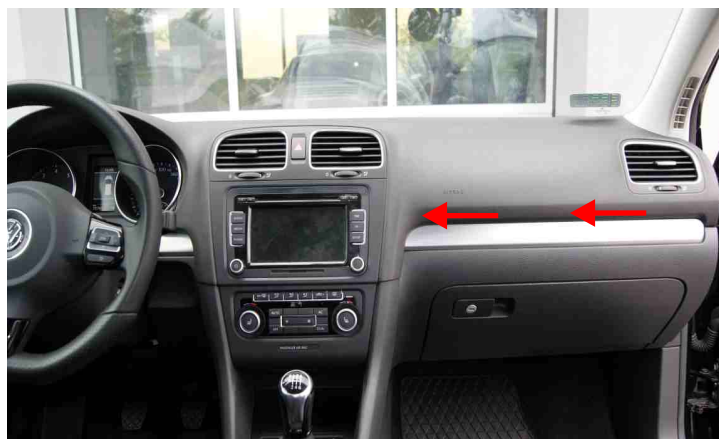A**3**


For proper microphone installation stretch the microphone cable so that it reaches the dome light area under the ceiling. Next take out the red-circled screws (picture B) and remove the lights.

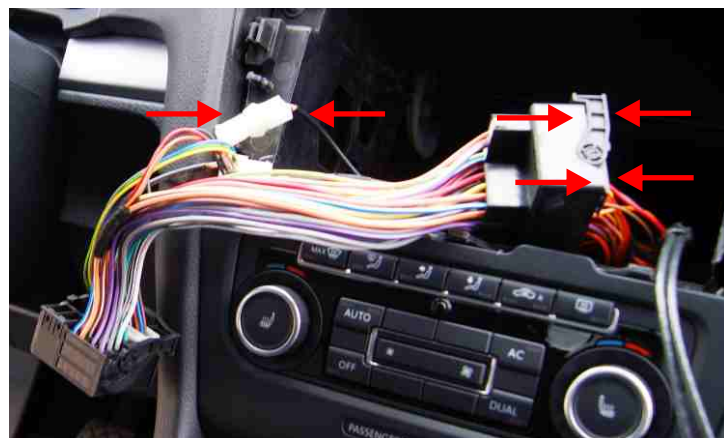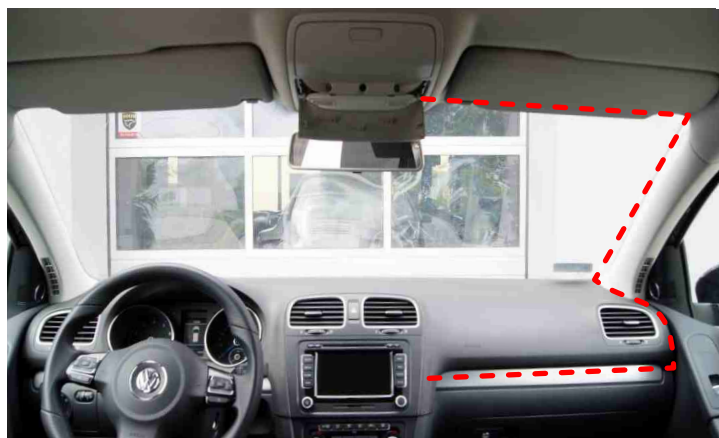B**A**

4


The place for microphone installation is marked red in the picture below. Install the microphone in this area. Then connect it with the microphone cable.

B

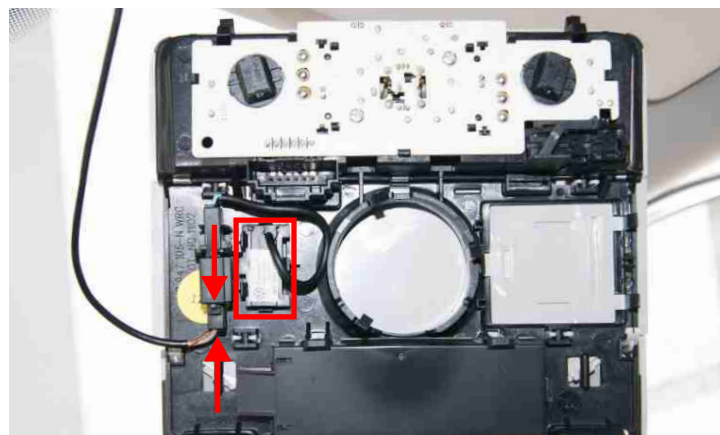

5

Bluetooth C38 module requires external GSM antenna. For GSM installation, as well as for extending and connecting the microphone cable with the Bluetooth module, dismantle the right front door post. Pull out the AIR BAG stopper and take out the screw underneath.

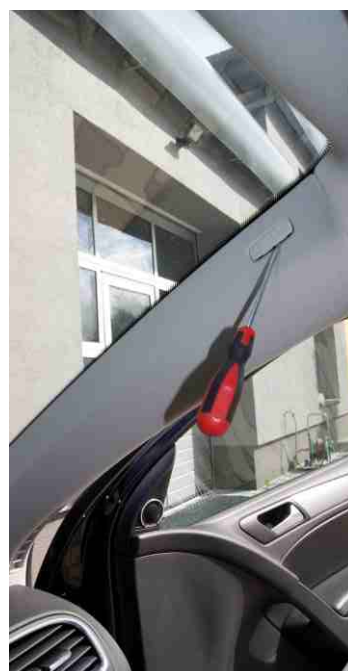

6

Fasten the GSM antenna in the area marked red in the picture below. Then stretch the GSM connector and the wire bundle to the right doorsill.




7

Dismantle the doorsill cover. Run the cable along the frame towards the passenger seat under which the Bluetooth module will be placed.

A




B

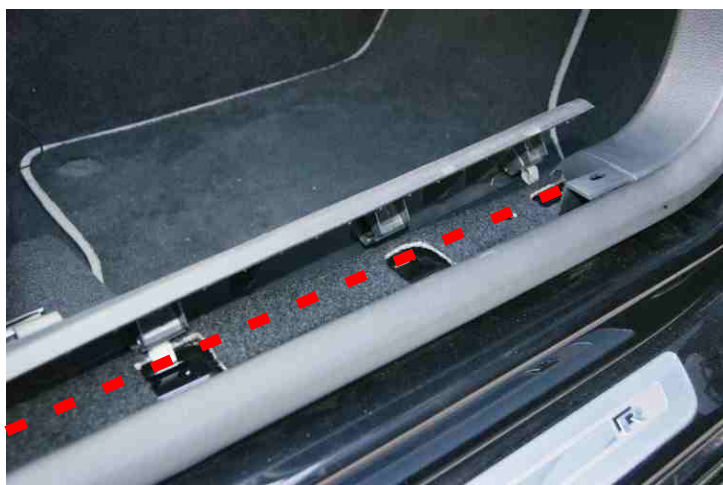


8

Connect the GSM antenna and the wire bundle to the Bluetooth module and implant everything under the front passenger seat. Next, adjust all elements in a reverse order.

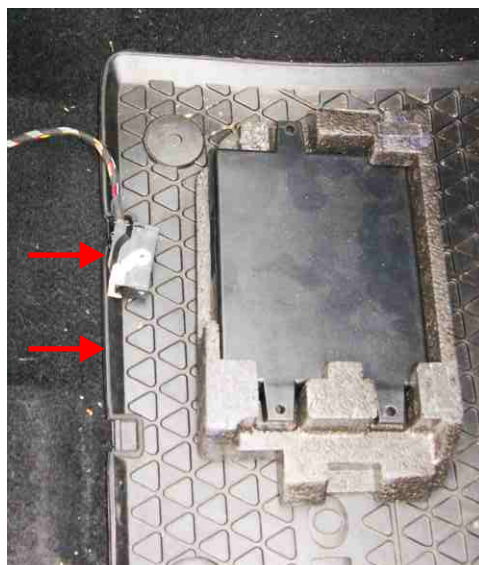


9

Use the VCDS diagnostic software. Open 19- Can Gateway.

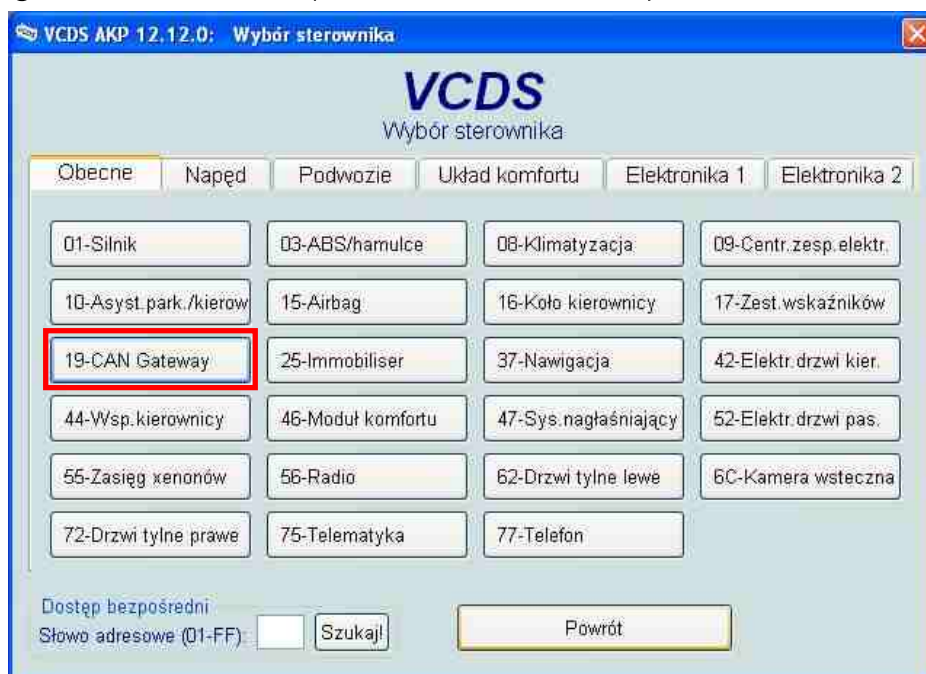


10

Open block Call register

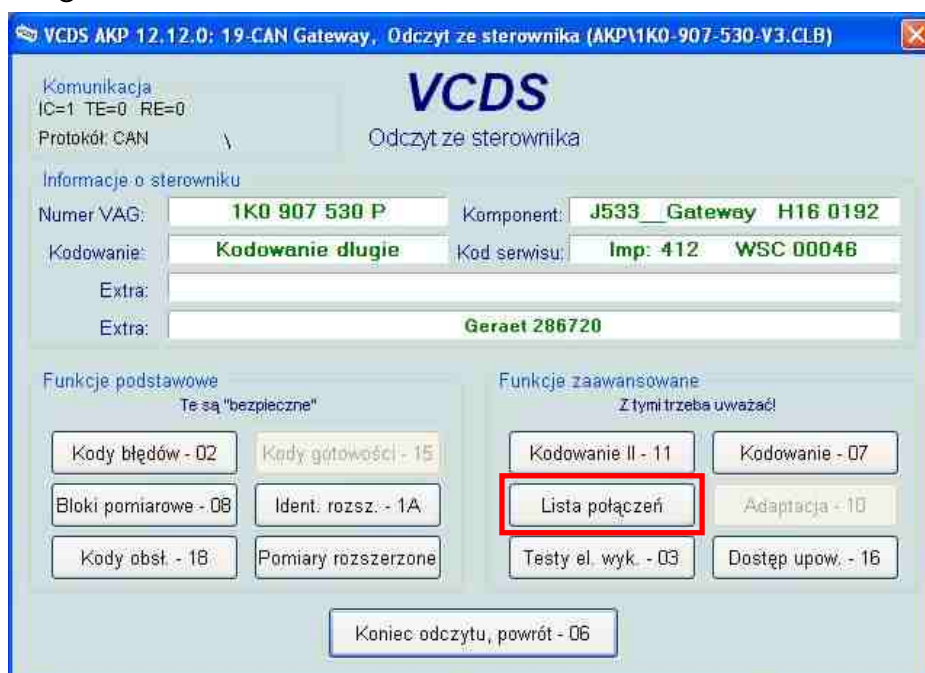


11

Tick off the entry for Telephone-77 and save changes

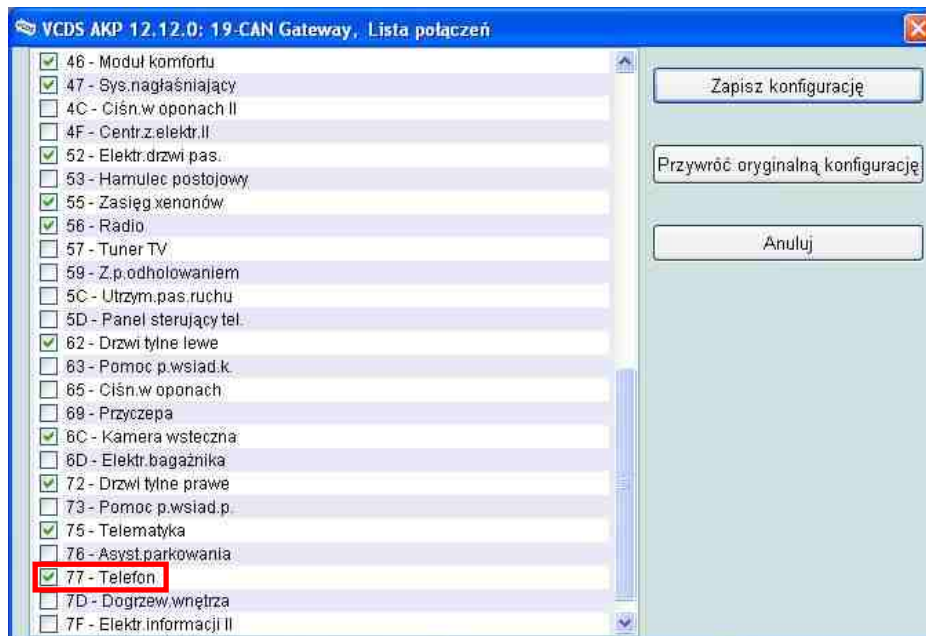

12

Open Telephone-77.

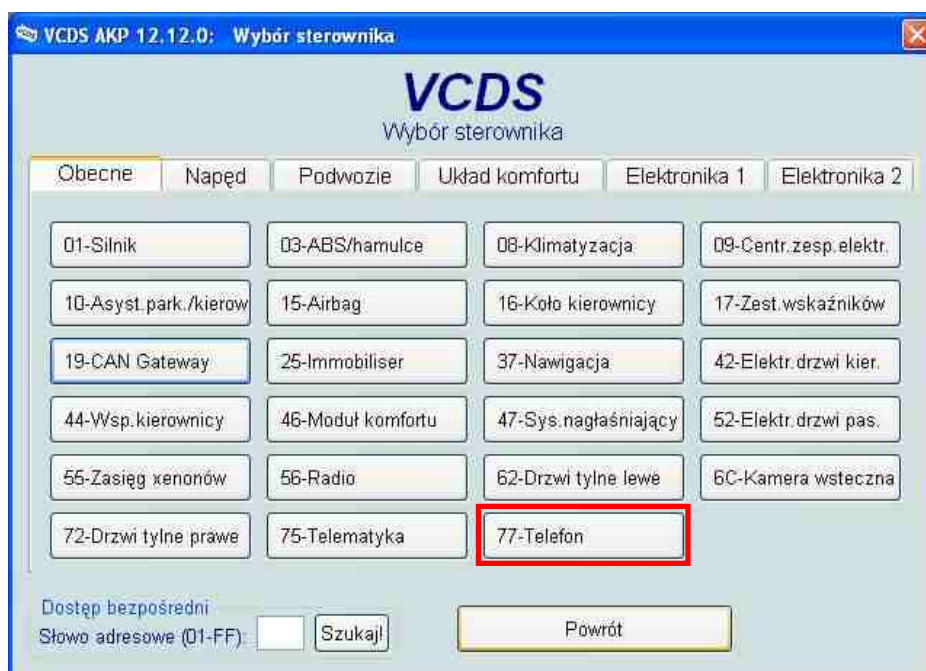

13

Open the help guide for coding and add your code number:

- For 3C8 035 730 C module: 02000000101000100000000000
- For 3C8 035 730D module: 02000000101000100000000100

VCDS AKP 12.12.0: 77-Telefon, Kodowanie

Przed dokonaniem jakichkolwiek zmian proszę zanotować aktualne wartości.
Niewłaściwe kodowanie może spowodować utratę funkcjonalności sterownika!

0 - 3C8 035 730 D Telefon 012 0822

Aktualne kodowanie:

02000000101000100000000000

Nowe kodowanie: Pomocnik kodowania

Kod serwisu (0 - 99999): 12345 Nr importera (0 - 999): 123 Nr urządzenia (0-262143): 12345

Wykonaj Anuluj

Save the code number and cancel possible errors.